

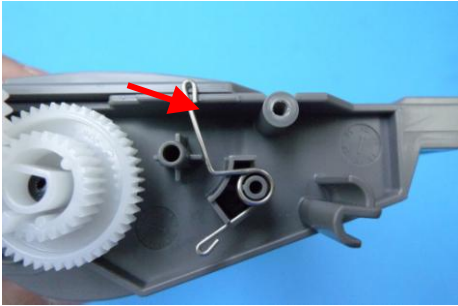
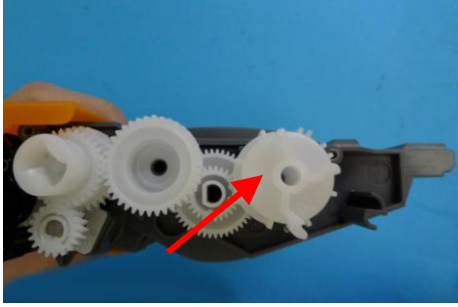



How to Install The T.P.E. CC1737 BROTHER HL2130/2220/2230/2240/2240D/2270DW/TN2060/2030/2010/410/2210/420/11J STANDARD YIELD RESET LEVER AND SPRING and CC1659 BROTHER HL-2130/2220/2230/2240/2240D/2270DW/TN2060/2030/2010/410/2220/2210/ 450/420/11J GEAR SIDE END CAP

<p>CC1737 BROTHER HL2130/2220/2230/2240/2240D/2270DW/TN2060/2030/2010/410/2210/420/11J STANDARD YIELD RESET LEVER AND SPRING</p>	<p>CC1659 BROTHER HL-2130/2220/2230/2240/2240D/2270DW/TN2060/2030/2010/410/2220/2210/ 450/420/11J GEAR SIDE END CAP</p>
	

Procedures

	<p><u>Step 1</u> Using the starter cartridge as shown. Unscrew the End Cap from the HL2130/2220/2230/2240/2240D/2270DW starter toner cartridge. Keep the small screws for reuse but the end cap needs to be replaced.</p>
	<p><u>Step 2</u> Installing the Reset Lever Spring. Make sure the straight tail of the Spring fits onto the platform at the toner cartridge side.</p>
	<p><u>Step 3</u> Put the T.P.E. STANDARD YIELD RESET LEVER on to the shaft as shown in the photo.</p>
	<p><u>Step 4</u> Install the T.P.E. CC1659 BROTHER HL-2130/2220/2230/2240/2240D/2270DW/TN2060/2030/2010/410/2220/2210/ 450/420/11J GEAR SIDE END CAP with two screws. It is important to make sure the position of the Reset Lever does not move. The pointed end of the triangular engraving "3" on the Reset Lever should be in line with the pointed end of the triangular engraving of the Gear Side End Cap as shown. If it is not and has moved, repeat steps 2, 3 and 4.</p>