


**INSTRUCTION FOR CONVERSION OF
HP Q7570A CARTRIDGE (HP LASERJET M5025MFP/M5035MFP) TO FIT IN
HP LASERJET PRO 700 M712 PRINTER**

Machining of HP Q7570A (HP LASERJET M5025MFP/M5035MFP) Waste Toner Hopper: Remove the raised ribs on the Waste Toner Hopper



Machining off HP Q7570A (HP LASERJET M5025MFP/M5035MFP) Waste Toner Hopper: Reduce the height of the drum bearing plate locating rib on the Waste Toner Hopper

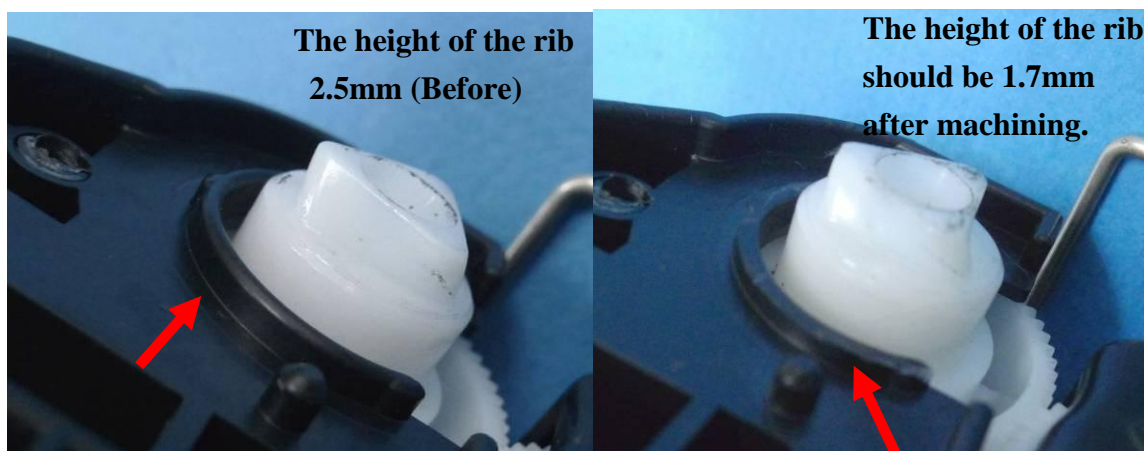

Replace the existing HP Q7570A (HP LASERJET M5025MFP/M5035MFP) Drum Bearing Plate with Triton CC1848 HP LASERJET PRO 700 M712 DRUM BEARING PLATE FOR HP M5025/M5035

CONVERSION

HP Q7570A (HP LASERJET M5025MFP/M5035MFP)



Replace with Triton CC1848 Drum Bearing Plate



- **HP Q7570A (HP LASERJET M5025MFP/M5035MFP) OEM Cartridge.**
 1. Remove the raised ribs on the **HP Q7570A (HP LASERJET M5025MFP/M5035MFP)** Waste Toner Hopper by Machining.
 2. Reduce the height of the drum bearing plate locating rib of the **HP Q7570A (HP LASERJET M5025MFP/M5035MFP)** Waste Toner Hopper to 1.7mm high.
 3. Replace the existing **HP Q7570A (HP LASERJET M5025MFP/M5035MFP)** Drum Bearing Plate with the Triton CC1848 HP LASERJET PRO 700 M712 DRUM BEARING PLATE FOR HP M5025/M5035 CONVERSION.